

## ⚠ Notes Of Installation

1. Please keep your hands clean and drying before installation.
2. Please use high quality and well-preserved tools when you strip the outer jacket and the coating layer.
3. Please use the correct ruler and cutter.
4. Please use well-preserved cutter to avoid the damage of the fiber facets.
5. Please appropriately dispose of the waste fiber to avoid personal injury.
6. When you insert the fiber, please pay attention to the method and pressure, to avoid damage to the fiber.
7. Insert the fiber carefully, ensure a slight bend is formed, then lock the lock catch.
8. Please pay attention to the place where you are instructed whether it is clean, as dust will affect the communication data.



## Instruction

SC/UPC-H01  
SC/APC-H01

## Embedded Quick Assembly Connector



Please read the instruction carefully before installation.

## Instruction


SC/UPC-H01 SC/APC-H01

## Embedded Quick Assembly Connector

Housing Butt joint Boot




1. Parts of connector

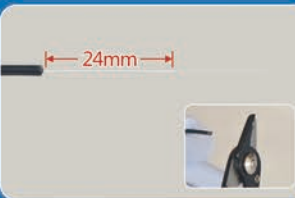

4. Remove the coating layer to 24mm.



2. Penetrate the fiber in the boot.

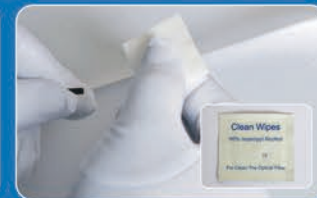

5. Use the airtid paper or other exclusive use wipes to clean the fiber.




3. Remove the outer jacket with the sheath stripper



6. Cut the fiber, the length of bare fiber is 10mm

Move the lock catch to the end

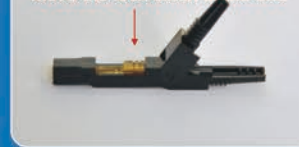

7. Ensure the lock catch is move to the end



10. Close the rear cover to clamp the fiber then screw the boot.

Fiber slight bend



8. Insert the fiber carefully, ensure a slight bend is formed to confirm that the fiber is fully inserted.



11. Cover the housing and finish the installation.

Move up the lock catch to lock fiber tighten



9. Keep the fiber slight bend then move up the lock catch to lock tighten.



12. For repeatedly using, move down the lock catch to release the fiber, screw out the boot, draw out the fiber, can be reassembly.

