


## Notes Of Installation

1. Please keep your hands clean and drying before installation.
2. Please use high quality and well-preserved tools when you strip the outer jacket and the coating layer.
3. Please use the correct ruler and cutter.
4. Please use well-preserved cutter to avoid the damage of the fiber facets.
5. Please appropriately dispose of the waste fiber to avoid personal injury.
6. When you insert the fiber, please pay attention to the method and pressure, to avoid damage to the fiber.
7. Insert the fiber carefully, ensure a slight bend is formed then to lock the lock catch.
8. Please pay attention to the place where you are instructed whether there is clean, the dust will affect the communication data.

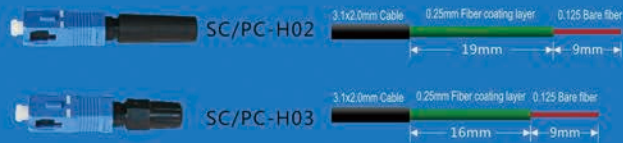

## Instruction

SC/PC-H02  
SC/PC-H03

## Embedded Quick Assembly Connector



Please read the instruction carefully before installation.

## Instruction

SC/PC-H02 SC/PC-H03

## Embedded Quick Assembly Connector

Housing Butt joint Boot

SC/PC-H02

SC/PC-H03

1. Parts of connector

2. Penetrate the fiber in the boot.

3. Remove the outer jacket with the sheath stripper

H02 ← 19mm →  
H03 ← 16mm →

4. Remove the coating layer to 24mm.

5. Use the airlaid paper or other exclusive use wipes to clean the fiber.

6. Cut the fiber, the length of bare fiber is 9mm

Move the lock catch to the end



7. Ensure the lock catch is move to the end

Fiber slight bend



8. Insert the fiber carefully, ensure a slight bend is formed to confirm that The fiber is fully inserted.

Move up the lock catch to lock fiber tighten



9. Keep the fiber slight bend then move up the lock catch to lock tighten.

Move down the lock catch release the fiber.



12. For repeatedly using, move down the lock catch to release the fiber, screw out the boot, draw out the fiber, can be reassembly.

10. Close the rear cover to clamp the fiber then screw the boot.

11. Cover the housing and finish the installation.